



**REPORT NUMBER: 102841566COQ-003a**  
**ORIGINAL ISSUE DATE: March 14, 2017**

**EVALUATION CENTER**  
Intertek Testing Services NA Ltd.  
1500 Brigantine Drive  
Coquitlam, B.C. V3K 7C1

**RENDERED TO**

**Structurlam Products Ltd.**  
**2176 Government Street**  
**Penticton, BC V2A 8B5**  
**CAN**

**PRODUCT EVALUATED: 4 in. thick SPF Crosslam CLT Panels**  
**EVALUATION PROPERTY: Surface Burning Characteristics**

**Report of testing 4 in. thick SPF Crosslam CLT Panels for compliance with the applicable requirements of the following criteria: ASTM E84-16a, *Standard Test Method for Surface Burning Characteristics of Materials.***

*This report is for the exclusive use of Intertek's Client and is provided pursuant to the agreement between Intertek and its Client. Intertek's responsibility and liability are limited to the terms and conditions of the agreement. Intertek assumes no liability to any party, other than to the Client in accordance with the agreement, for any loss, expense or damage occasioned by the use of this report. Only the Client is authorized to copy or distribute this report and then only in its entirety. Any use of the Intertek name or one of its marks for the sale or advertisement of the tested material, product or service must first be approved in writing by Intertek. The observations and test results in this report are relevant only to the sample tested. This report by itself does not imply that the material, product, or service is or has ever been under an Intertek certification program.*

# TEST REPORT

# 1 Table of Contents

---

	PAGE
1 Table of Contents .....	2
2 Introduction .....	3
3 Test Samples .....	3
3.1 SAMPLE SELECTION .....	3
3.2 SAMPLE AND ASSEMBLY DESCRIPTION .....	3
4 Testing and Evaluation Methods.....	4
4.1 TEST STANDARD.....	4
5 Testing and Evaluation Results .....	5
5.1 RESULTS AND OBSERVATIONS.....	5
6 Conclusion .....	6
APPENDIX A – Data Sheets .....	4 Pages
REVISION SUMMARY	

## 2 Introduction

---

Intertek Testing Services NA Ltd. (Intertek) has conducted testing for Structurlam Products Ltd., to evaluate the surface burning characteristics of 4 in. thick SPF Crosslam CLT Panels. Testing was conducted in accordance with the standard methods of ASTM E84-16a, *Standard Test Method for Surface Burning Characteristics of Materials*.

This evaluation began March 9, 2017 and was completed March 9, 2017.

## 3 Test Samples

---

### 3.1. SAMPLE SELECTION

Samples were randomly selected on January 25, 2017 by Intertek representative Dan Lungu. The sampling was conducted at Structurlam Products Ltd located at 2176 Government Street Penticton, BC The sample panels were received at the Evaluation Center on February 3, 2017.

### 3.2. SAMPLE AND ASSEMBLY DESCRIPTION

Upon receipt of the samples at the Intertek Coquitlam laboratory they were placed in a conditioning room where they remained in an atmosphere of  $23 \pm 3^{\circ}\text{C}$  ( $73.4 \pm 5^{\circ}\text{F}$ ) and  $50 \pm 5\%$  relative humidity.

The sample panels consisted of 4 in. thick SPF Crosslam CLT Panels. Each panel measured 24 in. wide by 6 ft. long by nominal 4in. thick. The moisture content ranged from 11.4% to 12.7%.

For each trial run, four 6 ft. long by 24 in. wide sample panels were butted together and placed on the upper ledge of the flame spread tunnel to form the required 24 ft. sample length. A layer of 6mm reinforced cement board was placed over top of the samples, the tunnel lid was lowered into place, and the samples were then tested in accordance with ASTM E84-16a.

## 4 Testing and Evaluation Methods

---

### 4.1. TEST STANDARD

The results of the tests are expressed by indexes, which compare the characteristics of the sample under tests relative to that of select grade red oak flooring and inorganic-cement board.

#### (A) Flame Spread Index:

This index relates to the rate of progression of a flame along a sample in the 25 foot tunnel. A natural gas flame is applied to the front of the sample at the start of the test and drawn along the sample by a draft kept constant for the duration of the test. An observer notes the progression of the flame front relative to time.

The test apparatus is calibrated such that the flame front for red oak flooring passes out the end of the tunnel in five minutes, thirty seconds (plus or minus 15 seconds).

#### (B) Smoke Developed:

A photocell is used to measure the amount of light, which is obscured by the smoke passing down the tunnel duct. When the smoke from a burning sample obscures the light beam, the output from the photocell decreases. This decrease with time is recorded and compared to the results obtained for red oak, which is defined to be 100.

## 5 Testing and Evaluation Results

---

### 5.1. RESULTS AND OBSERVATIONS

#### (A) Flame Spread

The resultant flame spread Indexes are as follows:  
(Index rounded to nearest 5)

4 in. thick SPF Crosslam CLT Panels	Flame Spread	Flame Spread Index
Run 1	38	40
Run 2	31	30

#### (B) Smoke Developed

The areas beneath the smoke developed curve and the related Indexes are as follows:  
(For smoke developed indexes 200 or more, index is rounded to the nearest 50. For smoke developed indexes less than 200, index is rounded to nearest 5)

4 in. thick SPF Crosslam CLT Panels	Smoke Developed	Smoke Developed Index
Run 1	54	55
Run 2	47	45

#### (C) Observations

During the test runs, surface ignition occurred between 29 and 30 seconds; the flame began to progress along the sample until it reached the maximum flame spread.

## 6 Conclusion

---

The 4 in. thick SPF Crosslam CLT Panels, submitted by Structurlam Products Ltd, exhibited the following flame spread characteristics when tested in accordance ASTM E84-16a, *Standard Test Method for Surface Burning Characteristics of Materials*.

4 in. thick SPF Crosslam CLT Panels	Flame Spread Index	Smoke Developed Index
Run 1	40	55
Run 2	30	45

The conclusions of this test report may be used as part of the requirements for Intertek product certification. A series of two test runs are required for Intertek product certification. Authority to Mark must be issued for a product to become certified.

### INTERTEK TESTING SERVICES NA LTD.

Tested and  
Reported by:

  
Greg Philip  
Technician – Building Products

Reviewed by:

  
Riccardo DeSantis  
Manager – Building Products

# APPENDIX A

## DATA SHEETS

ASTM E84-16a DATA SHEETS  
Run 1

ASTM E84

Page 1 of 2

Client: Structurlam Products Ltd  
Date: 03 09 2017  
Project Number: 102841566  
Test Number: 1  
Operator: Greg Philp  
Specimen ID: 4 in. thick Crosslam CLT Panels SPF Avg m/c 11.4%

TEST RESULTS

FLAMESPREAD INDEX: 40  
SMOKE DEVELOPED INDEX: 55

SPECIMEN DATA . . .

Time to Ignition (sec): 29  
Time to Max FS (sec): 585  
Maximum FS (feet): 9.6  
Time to 980 F (sec): Never Reached  
Time to End of Tunnel (sec): Never Reached  
Max Temperature (F): 642  
Time to Max Temperature (sec): 576  
Total Fuel Burned (cubic feet): 46.00

FS\*Time Area (ft\*min): 73.3  
Smoke Area (%A\*min): 37.9  
Unrounded FSI: 37.8  
Unrounded SDI: 53.5

CALIBRATION DATA . . .

Time to Ignition of Last Red Oak (Sec): 38.0  
Red Oak Smoke Area (%A\*min): 70.8

TESTED BY  
*[Signature]*

REVIEWED BY  
*[Signature]*



### ASTM E84-16a DATA SHEETS Run 1

Project No: 102841566

Page 2 of 2


FLAME SPREAD (ft)



Smoke (%A)



Temperature (°F)

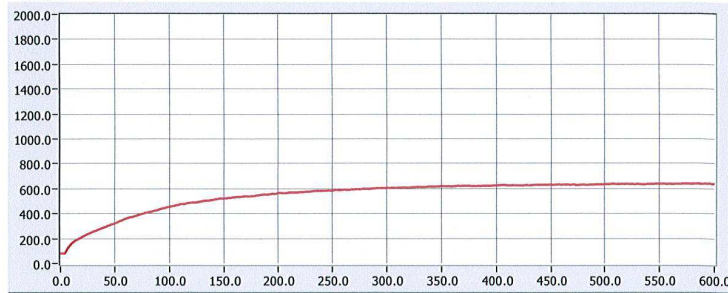

Time (sec)

600

*[Handwritten signature]*

*R1*

ASTM E84-16a DATA SHEETS  
Run 2

ASTM E84

Page 1 of 2

Client: Structurlam Products Ltd.

Date: 03 09 2017

Project Number: 102841566

Test Number: 2

Operator: Greg Philp

Specimen ID: 4 in. thick Crosslam CLT Panels SPF Avg m/c 12.7%

TEST RESULTS

FLAMESPREAD INDEX: 30

SMOKE DEVELOPED INDEX: 45

SPECIMEN DATA . . .

Time to Ignition (sec): 30

Time to Max FS (sec): 386

Maximum FS (feet): 7.4

Time to 980 F (sec): Never Reached

Time to End of Tunnel (sec): Never Reached

Max Temperature (F): 620

Time to Max Temperature (sec): 599

Total Fuel Burned (cubic feet): 45.80

FS\*Time Area (ft\*min): 61.0

Smoke Area (%A\*min): 33.6

Unrounded FSI: 31.4

Unrounded SDI: 47.4

CALIBRATION DATA . . .

Time to Ignition of Last Red Oak (Sec): 38.0

Red Oak Smoke Area (%A\*min): 70.8

TESTED BY  
*[Signature]*

REVIEWED BY

*[Signature]*

### ASTM E84-16a DATA SHEETS Run 2


Project No: 102841566

Page 2 of 2


FLAME SPREAD (ft)



Smoke (%A)

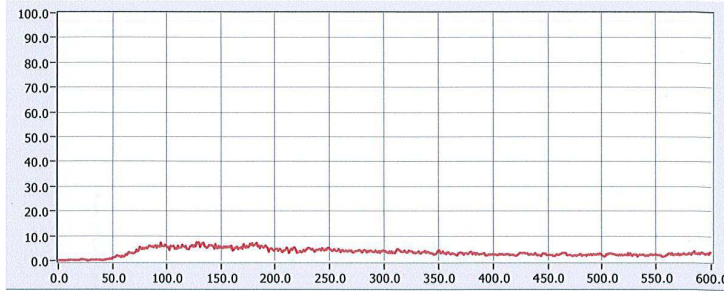

Temperature (°F)

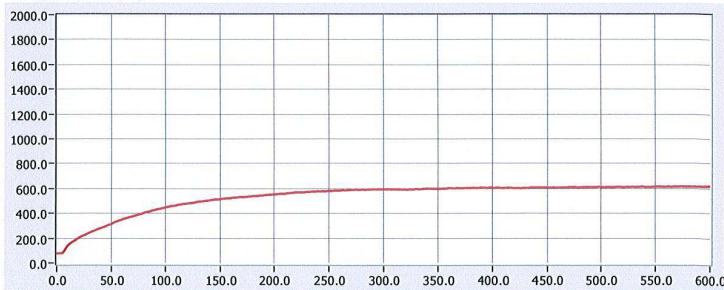

Time (sec)

600

## REVISION SUMMARY

<b>DATE</b>	<b>PAGE(S)</b>	<b>SUMMARY</b>
March 14, 2017	All	Original Issue Date